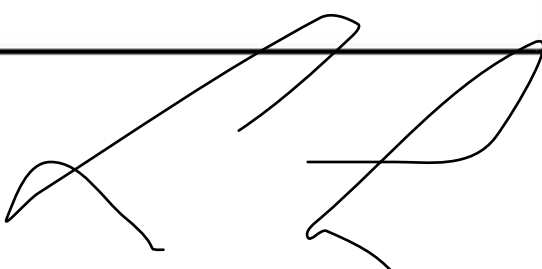


BUILDING ID	Elevation	Locality	Position	Yes/No	No.	Yes	No			
K1 K2 Modular	Upper level	External	Floor	Yes	66			Fibre Cement	Average	4
<i>Notes:</i> * Compressed sheeting to <u>verandahs</u> , both ends of the building - No Asbestos fibre detected. RENOVATED AND RELOCATED?										
K1 K2 Modular	Upper level	External	Wall	Yes	67			Fibre Cement	Average	4
<i>Notes:</i> * External wall sheeting to the upper level of the <u>Building</u> - No Asbestos fibre detected.										
Humanities	Lower level	Internal	Wall & Ceiling	Yes	68	Yes		Asbestos Cement	Poor	1
<i>Notes:</i> * <u>Millboard</u> sheeting used as wall & ceiling sheets to storeroom – kiln work area below Health Centre – Chrysotile & Amosite Asbestos fibres detected. HEALTH CARE CENTER + DAY CARE CENTER - NOT FOUND 10/04/2024										
Humanities	Lower level	Internal	Kiln	Yes	69	Yes		Asbestos Cement	Poor	1
<i>Notes:</i> * <u>Sheeting</u> to external panels of floor mounted kiln located in storeroom below Health Centre – Chrysotile Asbestos fibre detected										
Humanities	Lower level	Internal	Kiln	Yes	70			Fibre Cement	Average	4
<i>Notes:</i> * <u>Sheeting</u> to external panels of stand mounted kiln located in storeroom below Health Centre - No Asbestos fibre detected.										
Humanities	Lower level	Internal	Wall	No		Yes		Asbestos Cement	Average	4
<i>Notes:</i> * Internal wall sheeting to the storage area beneath the <u>Health</u> Centre is suspected to contain Asbestos fibre. FOUND 10/04/2024										
Humanities	Lower level	Internal	Ceiling tiles	Yes	71			Fibre Cement	Average	4
<i>Notes:</i>  * <u>Stored</u> ceiling tiles in storeroom below the Health Centre - No Asbestos fibre detected.										